

West Lafayette Lilly Nature Center

Staff Quarters

Locations	Non-Compliant Infraction		Compliant Remediation Procedure/Modification to Ensure Program Access	Criteria-ADAAG Architectural Barrier Removal Priorities						Supplemental Technical Information			
Locations	Identified Issue	ADAAG/PROWAG Specifications	Recommended Corrections	Priority #1	Priority # 2	Priority #3	Priority # 4	PROWAG	Recommended	Photo #	Conceptual Costs	Date to be corrected	Date Completed (Include Initials)
Exterior Accessible Routes	1. 1/4 in vertical rises exists at bottom of slope where sidewalks meet. 2. 8.0% running slope exists at entry of accessible route	ADAAG 303, 405, 505	1. Regrade sidewalk and ensure no rises exist exceeding 1/4". 2. 5% is the maximum running slope allowed for an accessible route. Install ramp railings on both sides of ramp complying with ADAAG 505.										
Entrance & Exit	1. Door floor stop at entry exists.	ADAAG 303, 307	1. Remove floor mounted door stop. Install wall mounted stop at 78" min. AFF.										
Kitchenette	1. Fire extinguisher's highest operable part is above 54" AFF and does not have clear approach as it is mounted above countertop. 2. Counters in kitchenette are mounted at 36" AFF.	ADAAG 309, 804	1. Relocate fire extinguisher to 48" max. AFF. to highest operable part with clear approach of 30" x 40" min. 2. Lower countertops to 34" max AFF.										
Bathroom	1. The bottom of the mirror is mounted at 43" AFF. 2. Toilet flush valve is on the wrong side. 3. Shower rod is at 70" AFF. 4. Toilet paper holder is located on wall behind water closet. 5. No grab bars exist by the toilet. 6. No visual alarm exists.	ADAAG 601, 307, 604, 702	1. Raise mirror so bottom is 40" min. AFF. 2. Replace toilet with a toilet having a right handed valve. 3. Raise shower rod to 80" min. AFF. 4. Relocate toilet paper holder to the wall beside the toilet. 5. Install grab bars if needed in future. 6. Install visual alarm @ 80" max. AFF.										